

Montageanleitung



N-Buchse, krimp/löt / Art. Nr.: 7372



1
Cut the cable end at right angled. Push the crimp sleeve and the anti-kink hose over the cable end.



2
Remove 18mm of outer jacket with a knife.



3
Bend up the copper braid right angled. Remove 6mm of the copper foil and 4mm of the dielectric with a knife.



4
Place the inner pin on the conductor and solder it through the hole.



5
Insert the end of the cable thus prepared into the socket housing as far as it will go (click). Twist the copper braid at right angles and cut with a side cutter. Push the sleeve as far as it will go.



6
Crimp the crimp sleeve with the crimping pliers; The copper mesh is clamped between the socket-housing and the crimping sleeve.



7
Push the anti-kink hose to the front until it is pushed and heat it up or shrink it with a hot air fan.