


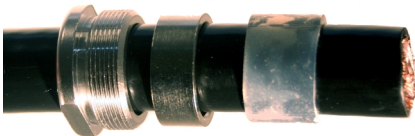

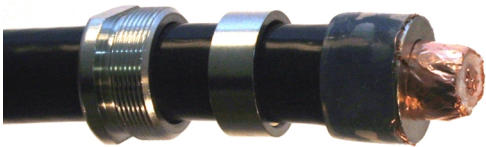

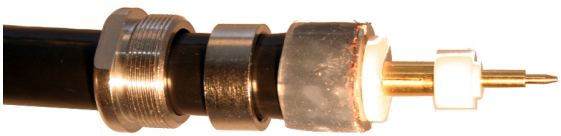

Mounting instruction



Ecoflex[®] 15, Ecoflex[®] 15 Plus

N plug solderless / Item no.: 7395 PRO

www.ssb-electronic.com

Required tools: 2 x open-ended spanner 19 mm 1 x cutter knife 1 x scissors 1 x metal saw 1 x small file		1		Cut off cable tail right-angled with a small metal saw. The inner conductor has to be kept absolutely round.
2		3		Remove 9 mm of the outer jacket with the cutter knife.
4		5		Remove the copper foil and the dielectric with a cutter knife. The inner conductor must stay absolutely round. Remove burr with the small file from sharp edges.
6		7		Tighten the clamping nut hand-tight with two 19 mm open-ended wrenches. A gap of 1 to 1,5 mm must still be visible between the nut and the connector housing!
Slide the Teflon insulator disc over the inner conductor. Then carefully attach the inner pin to the inner conductor. Then attach the 2nd Teflon insulator. Push the cable end prepared in this way into the connector housing as far as it will go.				